

Marina Marinaghi - White Shi - was**unayan asala (**gapa ya

Fwd: Building 4 Tunnel Leak

Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Tue, Dec 17, 2013 at 8:09 AM

To: Candice Taylor < ctaylor@caasti.com>

Cc: "act1001@aol.com" <act1001@aol.com>, Dave Kamrowski <david.kamrowski@gsa.gov>, Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Candice, please contact Dave K to coordinate possible repairs in this area.

Steve

----- Forwarded message -----

From: David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov>

Date: Tue, Dec 17, 2013 at 7:55 AM Subject: Fwd: Building 4 Tunnel Leak

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>, Daniel Bartley <daniel.bartley@gsa.gov>

Steve,

This is an area CAASTI worked. Even when our guys ensure the drain is free of clogs, the only way the water can get under the walking surface is if the seals around the trench drain and subsequent drainage system are not correct.

Please have CAASTI send out the appropriate sub contractor to investigate.

Thanks

----- Forwarded message -----

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:42 AM Subject: Building 4 Tunnel Leak

To: David Kamrowski <david.kamrowski@gsa.gov>

Dave:

Not sure if you need to mention this to Steve Y. as part of the masonry project, but water is leaking in from the sidewalk/deck above the double doors that lead into the UPS/1C courtyard. I have asked CMC to inspect the drain and remove any snow/ice that may be causing a back up but was not aware to what extent the deck was repaired and the drain modified as part of the project.

Thanks,

Daniel T. Bartley
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
(269) 425-3352

(h) (6)

daniel.bartley@gsa.gov

----- Forwarded message -----

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:37 AM

Subject:

To: Daniel Bartley daniel.bartley@gsa.gov


Daniel T. Bartley
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
(269) 425-3352

(b) (6

daniel.bartley@gsa.gov

David Kamrowski
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
269-425-3353, (b) (6) fax 269-961-7345
david.kamrowski@gsa.gov
www.gsa.gov/hdifedctr

Steve Yamasaki
Project Manager,MISC Technical team
GSA, PBS, Great Lakes Region, PMSC
230 South Dearborn Street Suite 3300
Chicago, IL 60604
(312) 353-1256 (b) (6) fax (312) 353-0240
steven.yamasaki@gsa.gov



IMG_20131216_084734_105.jpg 695K



Steven Yamasaki - SPSSSP1 <steven.yamasaki@gsa.gov/

Fwd: Building 4 Tunnel Leak

1 message

Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Tue, Feb 4, 2014 at 9:35 AM

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Cc: "act1001@aol.com" <act1001@aol.com>, Dave Kamrowski <david.kamrowski@gsa.gov>

Kathern, please have CAASTI contact Dave K to address the Building 4 tunnel leak; note originally sent 17Dec13 at 809am.

Steve

----- Forwarded message -----

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:09 AM Subject: Fwd: Building 4 Tunnel Leak To: Candice Taylor < ctaylor@caasti.com >

Cc: "act1001@aol.com" <act1001@aol.com>, Dave Kamrowski <david.kamrowski@gsa.gov>, Kathern Williams

- 5P2PQBC <kathern.williams@gsa.gov>

Candice, please contact Dave K to coordinate possible repairs in this area.

Steve

----- Forwarded message -----

From: David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov>

Date: Tue, Dec 17, 2013 at 7:55 AM Subject: Fwd: Building 4 Tunnel Leak

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>, Daniel Bartley <daniel.bartley@gsa.gov>

Steve,

This is an area CAASTI worked. Even when our guys ensure the drain is free of clogs, the only way the water can get under the walking surface is if the seals around the trench drain and subsequent drainage system are not correct

Please have CAASTI send out the appropriate sub contractor to investigate.

Thanks

----- Forwarded message -----

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:42 AM Subject: Building 4 Tunnel Leak

To: David Kamrowski <david.kamrowski@gsa.gov>

Dave:

Not sure if you need to mention this to Steve Y. as part of the masonry project, but water is leaking in from the sidewalk/deck above the double doors that lead into the UPS/1C courtyard. I have asked CMC to inspect the

drain and remove any snow/ice that may be causing a back up but was not aware to what extent the deck was repaired and the drain modified as part of the project.

Thanks,

Daniel T. Bartley
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
(269) 425-3352

(b) (6)

daniel.bartley@gsa.gov

----- Forwarded message -----

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:37 AM

Subject:

To: Daniel Bartley daniel.bartley@gsa.gov>

Daniel T. Bartley
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
(269) 425-3352

(b) (6)

daniel.bartley@gsa.gov

David Kamrowski
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
269-425-3353, (b) (6) fax 269-961-7345
david.kamrowski@gsa.gov
www.gsa.gov/hdifedctr



Steven Yamasaki - 5PSS3P1 ksteven.yamasaki@gsa.gov>

Re: Fwd: Building 4 Tunnel Leak

1 message

David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov>

Tue, Feb 4, 2014 at 2:15 PM

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Steve

CAASTI is not understanding. We are not asking them to fix the cracks or replace the insulation. That issue was dealt with previously.

CAASTI's new work should keep the water from getting to the cracks and to the insulation. That was the point of the repair.

You've captured the essence of the situation in your response.

On Tue, Feb 4, 2014 at 2:38 PM, Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov> wrote:

Before I respond to Kathern please comment on my comments in CAPS.

Steve Y

----- Forwarded message -----

From: ctaylor@caasti.com <ctaylor@caasti.com>

Date: Tue, Feb 4, 2014 at 1:32 PM

Subject: Re: Fwd: Building 4 Tunnel Leak

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>Cc: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Hello Kathern.

Per our conversation, here is the response from my sub sent Dec. 18, 2013. Please let me know if you have any questions.

From: Mike Ramey [mailto:mramey@ramservices.com] Sent: Wednesday, December 18, 2013 8:54 AM To: Tony Taylor Cc: James Nystrand Subject: RE: Building 4 Tunnel Leak

The ceiling cracks (which are leaking) are existing cracks that were there long (many years) before Ram started the trench drain work. NOT IN QUESTION. When this work was in process the existing waterproofing / insulation was totally saturated with water and ALL parties involved where made aware of this through many discussions over this issue. NOT IN QUESTION. If Caasti would like Ram to provide pricing to eliminate these leaks (which was not part of RAM's contract) please feel free to contact me and we can provide a proposal accordingly. SHOULDN'T THE ROOF WORK PERFORMED BY CAASTI HAVE ELIMINATED THE INFILTRATION OF WATER?

Thanks,

Mike

Mike Ramey

Project Manager/Estimator

RAM Construction Services

13800 Eckles Road

Livonia, MI 48152

mramey@ramservices.com

www.ramservices.com

P: (734) 464-3800

(b) (6

F: (734) 793-1924

On February 4, 2014 at 2:17 PM Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov> wrote:

Candice,

Please respond to trailing emails regarding the hazardous conditions at HDI.

Thank you.

Kathern M. Williams
Contracting Officer
Chicagoland & Customer Projects Contracting Branch
GSA, PBS, Great Lakes Region, Acquisition Management Division
230 S. Dearborn Street, Ste. 3300
Chicago, IL 60604
(312) 886-1060

(b) (6)

Fax (312) 353-9628 kathern.williams@gsa.gov

----- Forwarded message -----

From: Steven Yamasaki - 5PSS3P1 < steven.yamasaki@gsa.gov>

Date: Tue, Feb 4, 2014 at 9:35 AM Subject: Fwd: Building 4 Tunnel Leak

To: Kathern Williams - 5P2PQBC < kathern.williams@gsa.gov>

Cc: " act1001@aol.com" < act1001@aol.com>, Dave Kamrowski < david.kamrowski@gsa.gov>

Kathern, please have CAASTI contact Dave K to address the Building 4 tunnel leak; note originally sent 17Dec13 at 809am.



Steven Yamasaki - SPSS3P1, <seven.yamasaki@gsa.gev-

Re: Fwd: Building 4 Tunnel Leak

1 message

Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Tue, Feb 4, 2014 at 2:24 PM

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Cc: Dave Kamrowski <david.kamrowski@gsa.gov>, "act1001@aol.com" <act1001@aol.com>

The cracks are not the issue and never was; the leaking is the issue. The work was requested to eliminate the water penetrating the existing saturated waterproofing/insulation discovered during demolition. Please have CAASTI address the leaking.

Steve Y

On Tue, Feb 4, 2014 at 1:32 PM, ctaylor@caasti.com <ctaylor@caasti.com> wrote:

Hello Kathern.

Per our conversation, here is the response from my sub sent Dec. 18, 2013. Please let me know if you have any questions.

From: Mike Ramey [mailto:mramey@ramservices.com] Sent: Wednesday, December 18, 2013 8:54 AM To: Tony Taylor Cc: James Nystrand Subject: RE: Building 4 Tunnel Leak

The ceiling cracks (which are leaking) are existing cracks that were there long (many years) before Ram started the trench drain work. When this work was in process the existing waterproofing / insulation was totally saturated with water and ALL parties involved where made aware of this through many discussions over this issue. If Caasti would like Ram to provide pricing to eliminate these leaks (which was not part of RAM's contract) please feel free to contact me and we can provide a proposal accordingly.

Thanks,

Mike

Mike Ramey

Project Manager/Estimator

RAM Construction Services

13800 Eckles Road

Livonia, MI 48152



1 message



Steven Yamasaki - 5PSS3P1 Ksis ven.yamasaki@gsa.gov>

Fwd: Fwd: Building 4 Tunnel Leak

Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov></steven.yamasaki@gsa.gov>	Tue,	, Feb 4, 2014 at 1:38 PM
To: "act1001@aol.com" <act1001@aol.com>, Dave Kamrowski <david.kamrowski@gsa< th=""><th>a.gov</th><th>>, Jerry Carter</th></david.kamrowski@gsa<></act1001@aol.com>	a.gov	>, Jerry Carter
< Jarry Carter@smithgrounitr.com>		

Tue, Feb 4, 2014 at 1:38 P ⊉gsa.gov>, Jerry Carter
ase let me know if you have any
ember 18, 2013 8:54 AM To:
any years) before Ram started xisting waterproofing / insulation s through many discussions eliminate these leaks (which a proposal accordingly. THE INFILTRATION OF
•

Project Manager/Estimator

Mike Ramey

RAM Construction Services

13800 Eckles Road

Livonia, MI 48152

mramey@ramservices.com

www.ramservices.com

P: (734) 464-3800



F: (734) 793-1924

On February 4, 2014 at 2:17 PM Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov> wrote:

Candice,

Please respond to trailing emails regarding the hazardous conditions at HDI.

Thank you.

Kathern M. Williams
Contracting Officer
Chicagoland & Customer Projects Contracting Branch
GSA, PBS, Great Lakes Region, Acquisition Management Division
230 S. Dearborn Street, Ste. 3300
Chicago, IL 60604
(312) 886-1060

(b) (6)

Fax (312) 353-9628 kathern.williams@gsa.gov

----- Forwarded message -----

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Feb 4, 2014 at 9:35 AM Subject: Fwd: Building 4 Tunnel Leak

To: Kathern Williams - 5P2PQBC < kathern.williams@gsa.gov>

Cc: " act1001@aol.com" < act1001@aol.com>, Dave Kamrowski < david.kamrowski@gsa.gov>

Kathern, please have CAASTI contact Dave K to address the Building 4 tunnel leak; note originally sent 17Dec13 at 809am.

Steve

----- Forwarded message -----

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:09 AM Subject: Fwd: Building 4 Tunnel Leak

To: Candice Taylor < ctaylor@caasti.com>

Cc: "act1001@aol.com" < act1001@aol.com>, Dave Kamrowski < david.kamrowski@gsa.gov>,

Kathern Williams - 5P2PQBC < kathern.williams@gsa.gov>



Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Fwd: Building 4 Tunnel Leak

1 message

Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Tue, Feb 4, 2014 at 1:17 PM

To: ctaylor <ctaylor@caasti.com>

Cc: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Candice,

Please respond to trailing emails regarding the hazardous conditions at HDI.

Thank you.

Kathern M. Williams
Contracting Officer
Chicagoland & Customer Projects Contracting Branch
GSA, PBS, Great Lakes Region, Acquisition Management Division
230 S. Dearborn Street, Ste. 3300
Chicago, IL 60604
(312) 886-1060

(b) (6

Fax (312) 353-9628 kathern.williams@gsa.gov

------ Forwarded message -----

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Feb 4, 2014 at 9:35 AM Subject: Fwd: Building 4 Tunnel Leak

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Cc: "act1001@aol.com" <act1001@aol.com>, Dave Kamrowski <david.kamrowski@gsa.gov>

Kathern, please have CAASTI contact Dave K to address the Building 4 tunnel leak; note originally sent 17Dec13 at 809am.

Steve

----- Forwarded message ------

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:09 AM Subject: Fwd: Building 4 Tunnel Leak To: Candice Taylor <ctaylor@caasti.com>

Cc: "act1001@aol.com" <act1001@aol.com>, Dave Kamrowski <david.kamrowski@gsa.gov>, Kathern Williams

- 5P2PQBC <kathern.williams@gsa.gov>

Candice, please contact Dave K to coordinate possible repairs in this area.

Steve

----- Forwarded message -----

From: David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov>

Date: Tue, Dec 17, 2013 at 7:55 AM Subject: Fwd: Building 4 Tunnel Leak

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>, Daniel Bartley <daniel.bartley@gsa.gov>

Steve,

This is an area CAASTI worked. Even when our guys ensure the drain is free of clogs, the only way the water can get under the walking surface is if the seals around the trench drain and subsequent drainage system are not correct.

Please have CAASTI send out the appropriate sub contractor to investigate.

Thanks

----- Forwarded message -----

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:42 AM Subject: Building 4 Tunnel Leak

To: David Kamrowski <david.kamrowski@gsa.gov>

Dave:

Not sure if you need to mention this to Steve Y. as part of the masonry project, but water is leaking in from the sidewalk/deck above the double doors that lead into the UPS/1C courtyard. I have asked CMC to inspect the drain and remove any snow/ice that may be causing a back up but was not aware to what extent the deck was repaired and the drain modified as part of the project.

Thanks,

Daniel T. Bartley
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
(269) 425-3352

(b) (6)

daniel.bartley@gsa.gov

----- Forwarded message -----

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:37 AM

Subject:

To: Daniel Bartley <aniel.bartley@gsa.gov>

Daniel T. Bartley
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
(269) 425-3352

(b) (6)

daniel.bartley@gsa.gov



Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Re: Fwd: Fwd: Building 4 Tunnel Leak

1 message

David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov>
To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Thu, Feb 6, 2014 at 1:26 PM

Steve. They don't get it.

The work they did was suppose to keep most of the water on top of the wearing surface. The walking surface should drain into the trench drain. The walking surface was suppose to be caulked at the point of contact with the parapets. What water does get by the walking surface and caulking was suppose to be collected on top of the membrane and drain into the trench drain and drain out. The corner leaking profusely is worse than ever.

I am at a loss on how to make this any clearer.

From looking at detail 2/A503 it would appear the design would allow water, if the drain gets clogged, or frozen with recent temperatures, could back up between the walking surface and the membrane, and if the membrane is bad, it would allow water to get to the deck and enter the structure in any crack. However, the membrane on the west side of the trench drain is new as installed by this contractor. The leakage is on the southwest corner and entering the building on the west side of the trench.

How can they be so quick to blame the existing conditions without making a site visit to evaluate the conditions?

On Thu, Feb 6, 2014 at 1:40 PM, Paul Johnson < Paul. Johnson@smithgroupjjr.com > wrote:

Steve,

We would not expect the work performed by Caasti to eliminate all of the long term leakage conditions apparently present at this location for a protracted period of time. SGJJR was not involved in the design of the corrective work and we do not know what you were told, or what was expected.

I do not expect that the comments we had regarding the gutter in the past were related to leakage occurring at this time. Our concern was for water allowed to enter during the construction period.

Paul G. Johnson FAIA NCARB

Leader Building Technology Studio

SmithGroupJJR

500 Griswold, Suite 1700 Detroit, MI 48226

t 313.983.3600 d 313.442.8183

f 734.780.8959

Paul. Johnson@smithgroupjjr.com

Ranked #1 for design quality and #2 overall by Architect,

the magazine of the American Institute of Architects and

recipient of the 2011 Landscape Architecture Firm Award

from the American Society of Landscape Architects.

Connect with us! www.smithgroupjjr.com

The information contained within this email may be privileged, confidential and protected from disclosure. if you are not the intended recipient, any further disclosure or use, dissemination, distribution or copying of this message or any attachments thereto is strictly prohibited. If you think that you have received this email in error, please email the sender and delete this email. Thank you

From: Steven Yamasaki - 5PSS3P1 [mailto:steven.yamasaki@gsa.gov]

Sent: Wednesday, February 05, 2014 7:36 PM

To: Dave Kamrowski; Jerry Carter; Paul Johnson; act1001@aol.com

Subject: Fwd: Fwd: Fwd: Building 4 Tunnel Leak

Can this issue be resolved with a conference call or does it require a site visit?

Steve

----- Forwarded message -----

From: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Date: Wed, Feb 5, 2014 at 2:52 PM

Subject: Fwd: Fwd: Building 4 Tunnel Leak

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Please review Caasti response below.

Kathern M. Williams

Contracting Officer

Chicagoland & Customer Projects Contracting Branch

GSA, PBS, Great Lakes Region, Acquisition Management Division

230 S. Dearborn Street, Ste. 3300

Chicago, IL 60604

(312) 886-1060

1	

Fax (312) 353-9628

kathern.williams@gsa.gov

----- Forwarded message -----

From: ctaylor@caasti.com <ctaylor@caasti.com>

Date: Wed, Feb 5, 2014 at 2:39 PM

Subject: Re: Fwd: Fwd: Building 4 Tunnel Leak

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

How would installing a trench drain along the concrete slab within 2' of the edge repair an existing failed waterproofing system? The waterproof system in place is the problem. The leaks are from the failed system that we discussed with everyone onsite and CAASTI was instructed to ONLY install a trench drain.

On February 5, 2014 at 1:53 PM Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov> wrote:

Candice,

Please see Steve response below. Reply to me in regards to this.

Thanks.

Kathern M. Williams

Contracting Officer

Chicagoland & Customer Projects Contracting Branch

GSA, PBS, Great Lakes Region, Acquisition Management Division

230 S. Dearborn Street, Ste. 3300

Chicago, IL 60604

(312) 886-1060

(b) (6)

Fax (312) 353-9628

kathern.williams@gsa.gov

----- Forwarded message ------

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Feb 4, 2014 at 2:24 PM

Subject: Re: Fwd: Building 4 Tunnel Leak

To: Kathern Williams - 5P2PQBC < kathern.williams@gsa.gov>

Cc: Dave Kamrowski < david.kamrowski@gsa.gov>, " act1001@aol.com" < act1001@aol.com>

The cracks are not the issue and never was; the leaking is the issue. The work was requested to eliminate the water penetrating the existing saturated waterproofing/insulation discovered during demolition. Please have CAASTI address the leaking.

Steve Y

On Tue, Feb 4, 2014 at 1:32 PM, ctaylor@caasti.com <ctaylor@caasti.com> wrote:

Hello Kathern,

Per our conversation, here is the response from my sub sent Dec. 18, 2013. Please let me know if you have any questions.

From: Mike Ramey [mailto:mramey@ramservices.com] Sent: Wednesday, December 18, 2013 8:54. AM To: Tony Taylor Cc: James Nystrand Subject: RE: Building 4 Tunnel Leak

The ceiling cracks (which are leaking) are existing cracks that were there long (many years) before Ram started the trench drain work. When this work was in process the existing waterproofing / insulation was totally saturated with water and ALL parties involved where made aware of this through many discussions over this issue. If Caasti would like Ram to provide pricing to eliminate these leaks (which was not part of RAM's contract) please feel free to contact me and we can provide a proposal accordingly.

Thanks,

Mike

Mike Ramey

Project Manager/Estimator

RAM Construction Services

13800 Eckles Road

Livonia, MI 48152

mramey@ramservices.com

www.ramservices.com

P: (734) 464-3800



F: (734) 793-1924

On February 4, 2014 at 2:17 PM Kathern Williams - 5P2PQBC < kathern.williams@gsa.gov> wrote:

Candice,

Please respond to trailing emails regarding the hazardous conditions at HDI.

Thank you.

Kathern M. Williams

Contracting Officer

Chicagoland & Customer Projects Contracting Branch

GSA, PBS, Great Lakes Region, Acquisition Management Division

230 S. Dearborn Street, Ste. 3300

Chicago, IL 60604

(312) 886-1060

(b) (6)

Fax (312) 353-9628

kathern.williams@gsa.gov

----- Forwarded message -----

From: Steven Yamasaki - 5PSS3P1 < steven.yamasaki@gsa.gov>

Date: Tue, Feb 4, 2014 at 9:35 AM Subject: Fwd: Building 4 Tunnel Leak

To: Kathern Williams - 5P2PQBC < kathern.williams@gsa.gov> Cc: "act1001@aol.com" < act1001@aol.com>, Dave Kamrowski <

david.kamrowski@gsa.gov>

Kathern, please have CAASTI contact Dave K to address the Building 4 tunnel leak; note originally sent 17Dec13 at 809am.

Steve

------ Forwarded message ------

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:09 AM Subject: Fwd: Building 4 Tunnel Leak To: Candice Taylor < ctaylor@caasti.com>

Cc: " act1001@aol.com" < act1001@aol.com>, Dave Kamrowski <

david.kamrowski@gsa.gov>, Kathern Williams - 5P2PQBC < kathern.williams@gsa.gov>

Candice, please contact Dave K to coordinate possible repairs in this area.

Steve

----- Forwarded message ------

From: David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov>

Date: Tue, Dec 17, 2013 at 7:55 AM Subject: Fwd: Building 4 Tunnel Leak

To: Steven Yamasaki - 5PSS3P1 < steven.yamasaki@gsa.gov>, Daniel Bartley <

daniel.bartley@gsa.gov>

Steve,

This is an area CAASTI worked. Even when our guys ensure the drain is free of clogs, the only way the water can get under the walking surface is if the seals around the trench drain and subsequent drainage system are not correct.

Please have CAASTI send out the appropriate sub contractor to investigate.

Thanks

------ Forwarded message ------

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:42 AM Subject: Building 4 Tunnel Leak

To: David Kamrowski < david.kamrowski@gsa.gov>

Dave:

Not sure if you need to mention this to Steve Y. as part of the masonry project, but water is leaking in from the sidewalk/deck above the double doors that lead into the UPS/1C courtyard. I have asked CMC to inspect the drain and remove any snow/ice that may be causing a back up but was not aware to what extent the deck was repaired and the drain modified as part of the project.

Thanks,

Daniel T. Bartley

Property Manager

GSA/PBS Michigan Property Management Operations Branch

74 N. Washington Avenue, Room 2-1-6

Battle Creek, MI 49037

(269) 425-3352



daniel.bartley@gsa.gov

----- Forwarded message -----

From: Daniel Bartley - 5PSSCB <daniel.bartley@gsa.gov>

Date: Tue, Dec 17, 2013 at 8:37 AM

Subject:

To: Daniel Bartley < daniel.bartley@gsa.gov>

Daniel T. Bartley
Property Manager
GSA/PBS Michigan Property Management Operations Branch
74 N. Washington Avenue, Room 2-1-6
Battle Creek, MI 49037
(269) 425-3352

(b) (6)

daniel.bartley@gsa.gov

David Kamrowski

Property Manager

GSA/PBS Michigan Property Management Operations Branch

74 N. Washington Avenue, Room 2-1-6

Battle Creek, MI 49037

269-425-3353, (b) (6) fax 269-961-7345 david.kamrowski@gsa.gov www.gsa.gov/hdifedctr

Steve Yamasaki

Project Manager, MISC Technical team

GSA, PBS, Great Lakes Region, PMSC

230 South Dearborn Street Suite 3300

Chicago, IL 60604

(312) 353-1256 (b) (6) fax (312) 353-0240

steven.yamasaki@gsa.gov

Steve Yamasaki

Project Manager, MISC Technical team

GSA, PBS, Great Lakes Region, PMSC

230 South Dearborn Street Suite 3300

Chicago, IL 60604

(312) 353-1256 (b) (6) fax (312) 353-0240

steven.yamasaki@gsa.gov

Candice Taylor

CAASTI Contracting Services, Inc.

19115 West Eight Mile Rd

Detroit, MI 48219

313-535-9891 office / 313-535-9896

Every situation properly perceived becomes an opportunity

Steve Yamasaki

Project Manager, MISC Technical team

GSA, PBS, Great Lakes Region, PMSC

230 South Dearborn Street Suite 3300

Chicago, IL 60604

(312) 353-1256 (b) (6) fax (312) 353-0240

steven.yamasaki@gsa.gov

Candice Taylor

CAASTI Contracting Services, Inc.

19115 West Eight Mile Rd

Detroit, MI 48219

313-535-9891 office / 313-535-9896

Every situation properly perceived becomes an opportunity

Steve Yamasaki

Project Manager, MISC Technical team

GSA, PBS, Great Lakes Region, PMSC

230 South Dearborn Street Suite 3300

Chicago, IL 60604

(312) 353-1256 (b) (6) fax (312) 353-0240

steven.yamasaki@gsa.gov

David Kamrowski
Property Manager
Grand Rapids/Battle Creek Field Office
Michigan Property Management Operations Branch
GSA/PBS Northern Service Center Operations Division
74 N. Washington Avenue, Room 2-1-6, Battle Creek, MI 49037
269-425-3353, (b) (6) fax 269-961-7345
david.kamrowski@gsa.gov
www.gsa.gov/hdifedctr



Staven Yamasaki - 5PSS3P1 - stovon, yamacahi (d) gasa, qov>

Fwd: Fwd: Fwd: Building 4 Tunnel Leak

1 message

Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Tue, Feb 11, 2014 at 3:05 PM

To: Paul Johnson <paul.johnson@smithgroup.com>, Jerry Carter <Jerry.Carter@smithgroupjjr.com>, "act1001@aol.com" <act1001@aol.com>, Dave Kamrowski <david.kamrowski@gsa.gov>

Can we all meet on site to discuss the issue and plan our strategies with the Contractor during the week of 24Feb?

Steve

------ Forwarded message ------

From: David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov>

Date: Thu, Feb 6, 2014 at 1:26 PM

Subject: Re: Fwd: Fwd: Building 4 Tunnel Leak

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Steve. They don't get it.

The work they did was suppose to keep most of the water on top of the wearing surface. The walking surface should drain into the trench drain. The walking surface was suppose to be caulked at the point of contact with the parapets. What water does get by the walking surface and caulking was suppose to be collected on top of the membrane and drain into the trench drain and drain out. The corner leaking profusely is worse than ever.

I am at a loss on how to make this any clearer.

From looking at detail 2/A503 it would appear the design would allow water, if the drain gets clogged, or frozen with recent temperatures, could back up between the walking surface and the membrane, and if the membrane is bad, it would allow water to get to the deck and enter the structure in any crack. However, the membrane on the west side of the trench drain is new as installed by this contractor. The leakage is on the southwest corner and entering the building on the west side of the trench.

How can they be so guick to blame the existing conditions without making a site visit to evaluate the conditions?

On Thu, Feb 6, 2014 at 1:40 PM, Paul Johnson < Paul. Johnson@smithgroupjjr.com > wrote:

Steve,

We would not expect the work performed by Caasti to eliminate all of the long term leakage conditions apparently present at this location for a protracted period of time. SGJJR was not involved in the design of the corrective work and we do not know what you were told, or what was expected.

I do not expect that the comments we had regarding the gutter in the past were related to leakage occurring at this time. Our concern was for water allowed to enter during the construction period.

Paul G. Johnson FAIA NCARB

Leader Building Technology Studio

SmithGroupJJR

500 Griswold, Suite 1700 Detroit, MI 48226

t 313.983.3600 d 313.442.8183 f 734.780.8959

Paul. Johnson@smithgroupjjr.com

Ranked #1 for design quality and #2 overall by Architect, the magazine of the American Institute of Architects and recipient of the 2011 Landscape Architecture Firm Award from the American Society of Landscape Architects.

Connect with us! www.smithgroupjjr.com

The information contained within this email may be privileged, confidential and protected from disclosure. If you are not the intended recipient, any further disclosure or use, dissemination, distribution or copying of this message or any attachments thereto is strictly prohibited. If you think that you have received this email in error, please email the sender and delete this email. Thank you

From: Steven Yamasaki - 5PSS3P1 [mailto:steven.yamasaki@gsa.gov]

Sent: Wednesday, February 05, 2014 7:36 PM

To: Dave Kamrowski; Jerry Carter; Paul Johnson; act1001@aol.com

Subject: Fwd: Fwd: Building 4 Tunnel Leak

Can this issue be resolved with a conference call or does it require a site visit?

Steve

----- Forwarded message -----

From: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Date: Wed, Feb 5, 2014 at 2:52 PM

Subject: Fwd: Fwd: Building 4 Tunnel Leak

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>



Steven Vamasaki - 5PSSSP1 Skieven yamesaki@gaa.gov

RE: Fwd: Fwd: Building 4 Tunnel Leak

1 message

Jerry Carter < Jerry. Carter@smithgroupjjr.com>

Thu, Feb 20, 2014 at 12:58 PM

To: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Cc: Paul Johnson <Paul.Johnson@smithgroupjjr.com>, "act1001@aol.com" <act1001@aol.com>, David Kamrowski

- 5PSSCB <david.kamrowski@gsa.gov>

Steve,

Paul cannot make the meeting tomorrow morning, something came up. Paul and I will sit down soon to find another date to reschedule.

Thanks,

Jerry

From: Paul Johnson

Sent: Thursday, February 13, 2014 3:54 PM

To: Steven Yamasaki - 5PSS3P1; David Kamrowski - 5PSSCB

Cc: Jerry Carter; act1001@aol.com

Subject: RE: Fwd: Fwd: Building 4 Tunnel Leak

I will plan on being there about 10 AM on Feb. 21.

Paul G. Johnson FAIA NCARB

Leader Building Technology Studio

SmithGroupJJR

500 Griswold, Suite 1700 Detroit, MI 48226

t 313,983.3600 d 313.442.8183

f 734,780,8959

Paul. Johnson@smithgroupjjr.com

Ranked #1 for design quality and #2 overall by Architect,

the magazine of the American Institute of Architects and

recipient of the 2011 Landscape Architecture Firm Award

from the American Society of Landscape Architects.

Connect with us! www.smithgroupjjr.com

The information contained within this email may be privileged, confidential and protected from disclosure. if you are not the intended recipient, any further disclosure or use, dissemination, distribution or copying of this message or any attachments thereto is strictly prohibited. If you think that you have received this email in error, please email the sender and delete this email. Thank you

From: Steven Yamasaki - 5PSS3P1 [mailto:steven.yamasaki@gsa.gov]

Sent: Thursday, February 13, 2014 2:55 PM

To: David Kamrowski - 5PSSCB

Cc: Jerry Carter; Paul Johnson; act1001@aol.com **Subject:** Re: Fwd: Fwd: Building 4 Tunnel Leak

Please plan on 21Feb. I don't think I can make it in time to meet in the am but please feel free to just let me know the results.

Thanks,

Steve Y

On Thu, Feb 13, 2014 at 1:51 PM, David Kamrowski - 5PSSCB <david.kamrowski@gsa.gov> wrote:

The three dates Jerry has open, the 21st, 1st and 7th are good in the AM, I have a commitment from 1 to 2 each day.

On Thu, Feb 13, 2014 at 1:52 PM, Jerry Carter < Jerry Carter@smithgroupjjr.com> wrote:

Steve,

Paul has the following dates currently available:



Steven Yamasaki - 5PSS3P1 < steven.yamasaki@qsa.gov>

Battle Creek Federal Center tunnel- Special report March 7th, 2014

1 message

ACT1001@aol.com <ACT1001@aol.com>

To: paul.johnson@smithgroup.com

Cc: david.kamrowski@gsa.gov, STEVEN.YAMASAKI@gsa.gov SELT TO PARTITIONAL

Please see the attachment for the stated report.

Thank you,

Steve Adams

Adams Construction Technology

269-217-5620

BC Masonry 03-07-14 (Special report).pdf

Mon, Mar 10, 2014 at 10:31 AM

		:	
•		ü	
		an gar	
		·	
·	}		
		•	

*** CONSTRUCTION PROGRESS REPORT ***

"Roof Replacement & Masonry repairs"

Hart Dole Inouye Federal Center, Battle Creek, Michigan

Architect:

Smith Group JJR 500 Grisworld Street, Suite 1700 Detroit, MI 48226 wayne.bills@smithgroupjjr.com

Contractor:

Caasti Contracting Svcs. Inc. 19215 West Eight Mile Road Detroit, MI. 48219 ctaylor@caasti.com

Workers on the job site:

Superintendent: Weather: N/A

GSA Contracting Officer Representative:

Mr. Steve Yamasaki 230 S. Dearborn Street Suite 3800 Chicago, IL 60604 steven.yamasaki@gsa.gov

GSA Field Office:

Mr. Dave Kamrowski 74 North Washington St. Battle Creek, MI david.kamrowski@gsa.gov

0 (see report for more details)

Candice Taylor Temp. RangeN/A

DATE: 09-04-13

Caasti Contracting Svcs. Inc. (General Contractor)

I met with Dave Kamrowski (GSA Property Manager) this morning to discuss the issues GSA is experiencing this year during the winter months at the tunnel where the new trench drain was installed.

Water back-ups

- a) The property manager explained; he is observing more water coming through the tunnel ceiling that before the installation.
- b) Dave instructed his grounds crew to add salt to this area to keep the ice built-up down.
- c) He feels the water is freezing and backing up under the waterproofing and getting into the space below.
- d) See photos included in the end of this report.


Recent discovery concerning flashing around the trench drain

a) During the time with the property manager we reviewed the contract documents and discovered a deficiency in the contractor's installation.
b) It was discovered by the job site photos that the contractor failed to add the proposed flashing shown in the contract documents. This flashing was suppose to run horizontal to the parapet wall and then up the wall into an existing riglet.


This flashing or waterproofing was not installed. The waterproofing on the other side of the trench drain was installed and tied into the existing as proposed except at the end where leaking is observed.

d) See photos included at the end of this report showing the deficiency.

Job site photos taken during the trench drain installation process to follow:

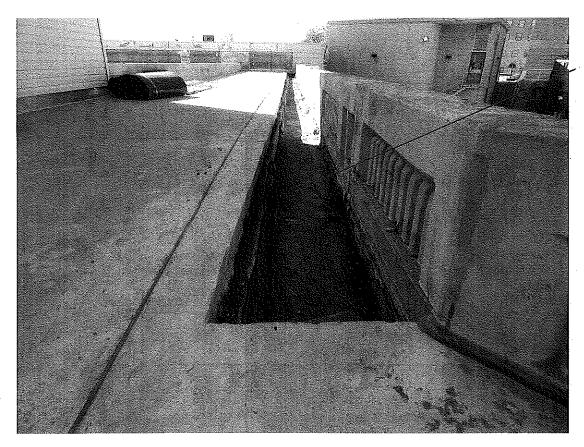


Demolition of the trench drain area. coating applied.

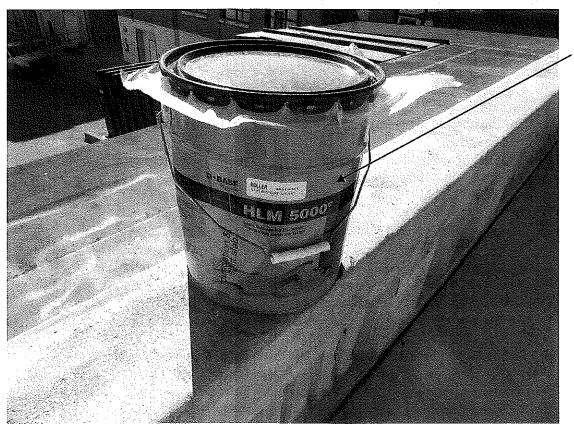


The coating used.

Page 2 of 9

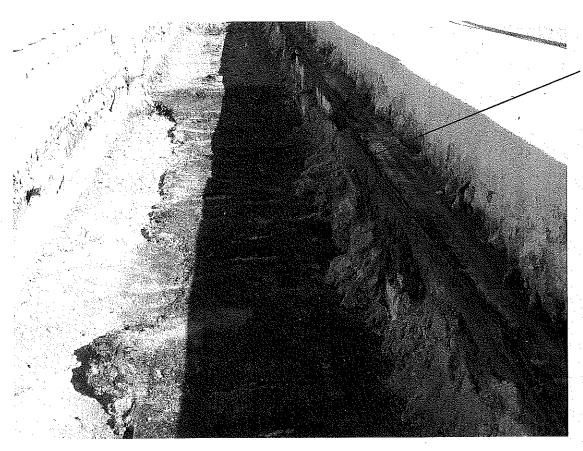


Another view of the trench after the first demolition work.

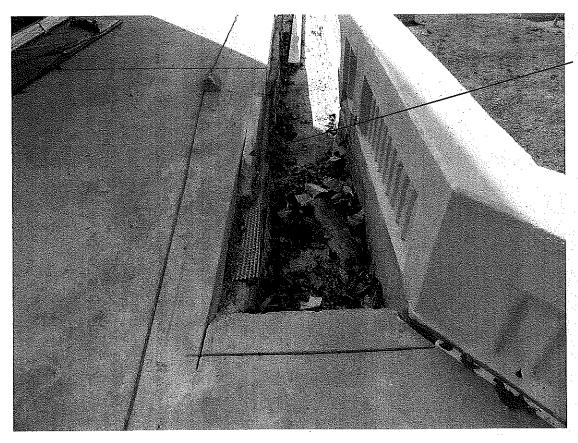

Extra cuts on concrete slab.

Page 3 of 9

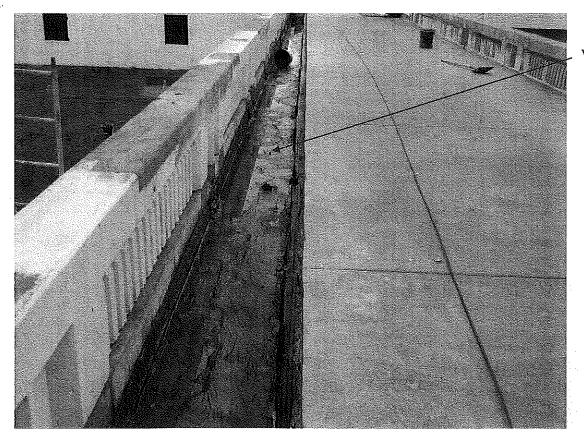


View of the trench with coating.




More demolition of the area where the drain will rest.

Adding new coating at new demolition.

Page 4 of 9

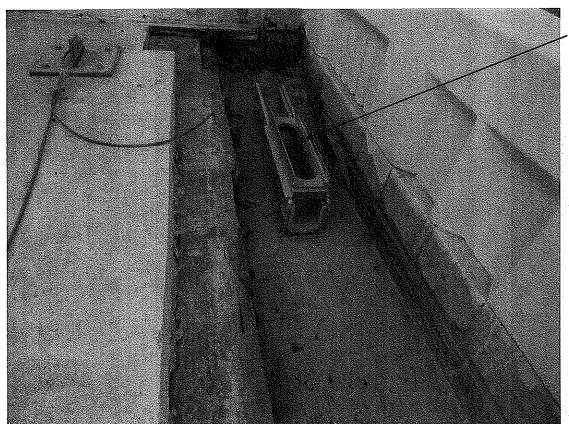


Fitting the trench drain in place.

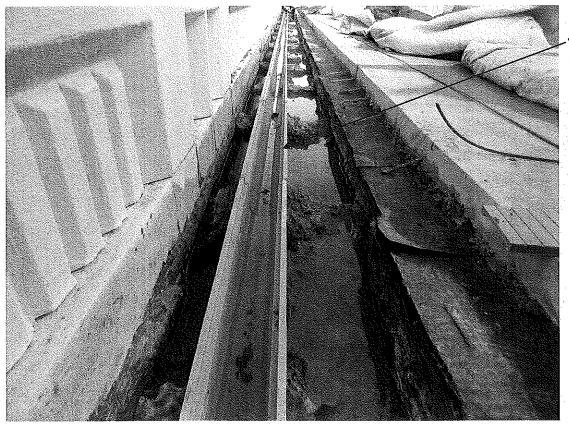

The trench drain set in place.

Page 5 of 9

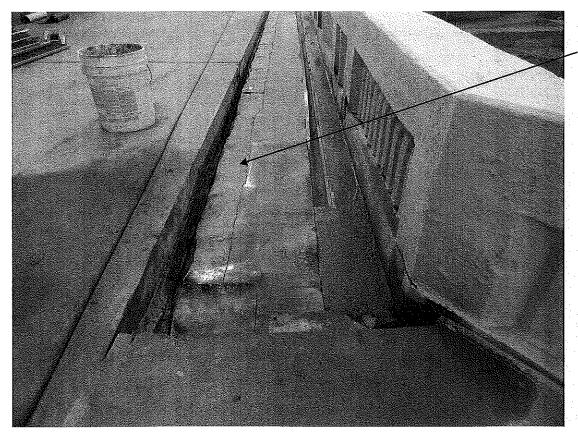


The existing water proofing tied into




Concrete added around the new trench drain. No sealant at expansion joints.

Page 6 of 9

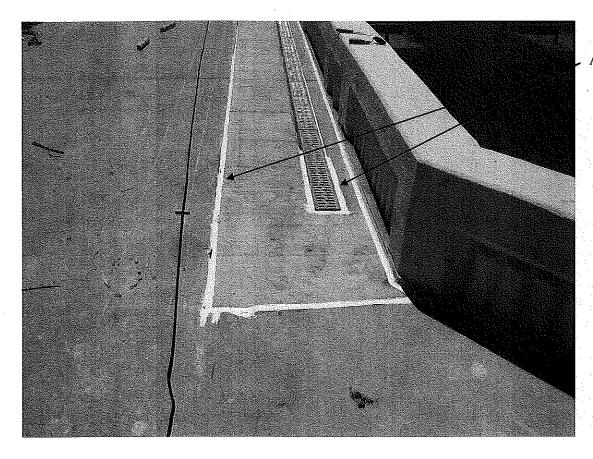


Adding the sealant,

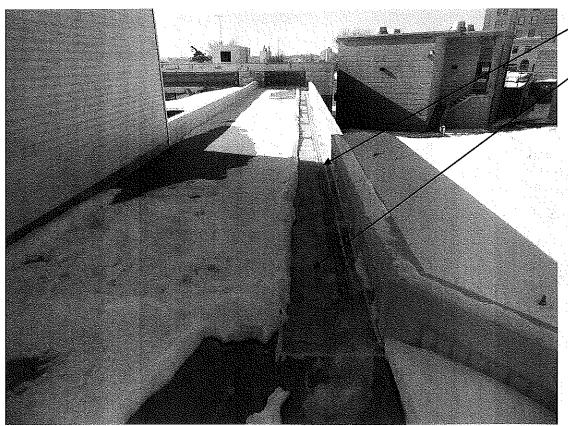


Current March 7th view.

GSA using salt to keep the water from freezing and backing up.

Page 7 of 9

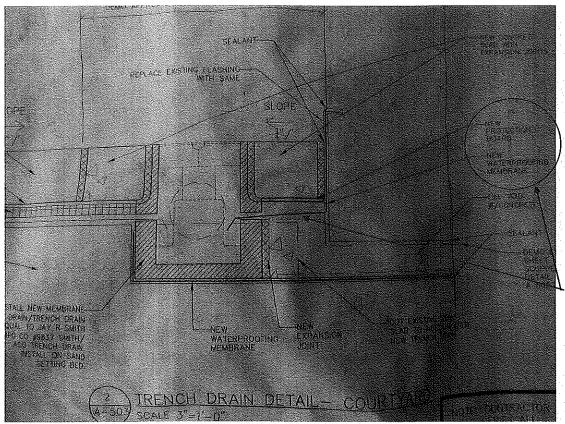

The protection board and waterproofing membrane not installed as specified.

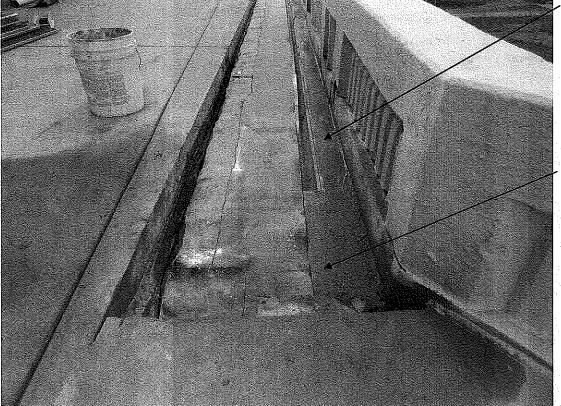

Job site photo of this area that showing no membrane or protection board.

This is an area that is leaking.

This concludes this report for March 07, 2014

> Steve Yamasaki, Dave Kamrowski, Smith Group, Wayne Bills & Paul Johnson, Candice Taylor (General Contractor)

If there are any misunderstandings or omissions in this report, please notify Adams Construction Technology or the office of the Architect within 3 business days of receiving it. If any revisions are made, revised copies will be reissued. Please address any correspondence to: Steve Adams in one of the following ways, e-mail- ACT1001@aol.com phone - 269-217-5620

REPORTED BY:

Steve Adams

Adams Construction Technology Phone - 269-217-5620 E-mail - ACT1001@aol.com

· · · · · · · · · · · · · · · · · · ·		
		*
·		
•		•



Steven Yamasaki - 5PSS3P1 < steven.yamasaki@gsa.gov>

Re: Battle Creek Federal Center tunnel- Special report March 7th, 2014

1 message

Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Wed, May 14, 2014 at 3:32 PM

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Cc: Daniel Kammann <aniel.kammann@gsa.gov>, "act1001@aol.com" <act1001@aol.com>, Jerry Carter - Springer-Indianols: 1001@aol.com, Jerry Carter - Spr

I'd rather not waste any more of my time for Candice's lack of asking Tony and RAM for an update. This issue has been discussed at meetings for quite a while. It's leaking so fix it.

Steve Y

On Tue, May 13, 2014 at 12:49 PM, Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov> wrote:

Please see Candace's response to A/E report regarding tunnel leak. According to my notes, we sent report report to Tony and Candice on 4/1/14 regarding this issue with no response. Do you have anything different?

Also, was this issue pressing enough to halt the project?

Kathern M. Williams
Contracting Officer
Chicagoland & Customer Projects Contracting Branch
GSA, PBS, Great Lakes Region, Acquisition Management Division
230 S. Dearborn Street, Ste. 3300
Chicago, IL 60604
(312) 886-1060



Fax (312) 353-9628 kathern.williams@gsa.gov

----- Forwarded message ------

From: Candice Taylor < Ctaylor@caasti.com>

Date: Tue, May 6, 2014 at 3:30 PM

Subject: RE: Battle Creek Federal Center tunnel- Special report March 7th, 2014

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Kathern,

I have a serious problem with this report. It is said that this report was done in 09/04/13. We were notified for the first time this early winter. Why were we not notified if there was an issue beforehand? Why did they not stop construction if these issues were occurring. This report has seem to have shown up out of nowhere. Also, you have my name on it when I had absolutely no information on this report. Please advise.

From: Kathern Williams - 5P2PQBC [mailto:kathern.williams@gsa.gov]

Sent: Tuesday, May 06, 2014 2:56 PM

To: Candice Taylor

Subject: Fwd: Battle Creek Federal Center tunnel- Special report March 7th, 2014

Kathern M. Williams

Contracting Officer

Chicagoland & Customer Projects Contracting Branch

GSA, PBS, Great Lakes Region, Acquisition Management Division

230 S. Dearborn Street, Ste. 3300

Chicago, IL 60604

(312) 886-1060

(b) (6)

Fax (312) 353-9628

kathern.williams@gsa.gov

----- Forwarded message -----

From: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

Date: Tue, Apr 1, 2014 at 4:59 PM

Subject: Fwd: Battle Creek Federal Center tunnel- Special report March 7th, 2014

To: Tony Taylor <ttaylor@caasti.com>, ctaylor@caasti.com>

Tony,

Please review the attached report addressing the issue of the tunnel leak at Building #4.

Thank you.

Kathern M. Williams

Contracting Officer

Chicagoland & Customer Projects Contracting Branch

GSA, PBS, Great Lakes Region, Acquisition Management Division

230 S. Dearborn Street, Ste. 3300

Chicago, IL 60604

(312) 886-1060



Fax (312) 353-9628

kathern.williams@gsa.gov

----- Forwarded message -----

From: Steven Yamasaki - 5PSS3P1 <steven.yamasaki@gsa.gov>

Date: Tue, Apr 1, 2014 at 4:22 PM

Subject: Fwd: Battle Creek Federal Center tunnel- Special report March 7th, 2014

To: Kathern Williams - 5P2PQBC <kathern.williams@gsa.gov>

fyi

----- Forwarded message -----

From: <ACT1001@aol.com>

Date: Mon, Mar 10, 2014 at 10:31 AM

Subject: Battle Creek Federal Center tunnel- Special report March 7th, 2014

To: paul.johnson@smithgroup.com

Cc: david.kamrowski@gsa.gov, STEVEN.YAMASAKI@gsa.gov

Please see the attachment for the stated report.

Thank you,

Steve Adams

Adams Construction Technology

269-217-5620

Steve Yamasaki

Project Manager, MISC Technical team

GSA, PBS, Great Lakes Region, PMSC

230 South Dearborn Street Suite 3300

Chicago, IL 60604

(312) 353-1256 (b) (6) fax (3°

fax (312) 353-0240

steven.yamasaki@gsa.gov

Steve Yamasaki
Project Manager,MISC Technical team
GSA, PBS, Great Lakes Region, PMSC
230 South Dearborn Street Suite 3300
Chicago, IL 60604
(312) 353-1256 (b) (6) fax (312) 353-0240
steven.yamasaki@gsa.gov